

Case 301 : Narrative

Case Vehicle (A): 2000 Mercury	Vehicle (B): 1994 Oldsmobile
Type: Cougar, 2-door coupe	Type: Bravada MPV, 4-door
Driver: 45-year-old female	Driver: 43-year-old female
CDC: 12-FDAW-6	CDC: 12-FDEW-4, 00-RDAO-2

This is a fatal crash. Both drivers sustained fatal injuries in this severe head-on impact.

SITUATION

[1](#) [2](#) [3](#) On a clear night, case vehicle (A) was traveling north at an unknown speed on a two-lane asphalt road, in a rural area. The road surface was dry, it was dark and unlighted, and the speed limit was 45 mph (72 kph). [4](#) Vehicle (B) was traveling south at an unknown speed on the same roadway when the driver of vehicle (B) probably fell asleep or lost consciousness because of high drug and blood alcohol levels. [5](#) Vehicle (B) crossed the centerline, entered the northbound lane and struck case vehicle (A) head-on. [6](#) [7](#) After the impact, case vehicle (A) was pushed rearward, rotated counterclockwise, and came to rest partially off the road facing in a northeast direction. After the impact, vehicle (B) rotated counterclockwise and rolled one-quarter turn onto its right side. The driver of vehicle (B) reportedly used drugs and alcohol prior to the crash, and her blood alcohol level was .28 percent. She also tested positive for cocaine, cocaethylene, and benzoylecgonine. Both vehicles were towed due to damage. The driver of case vehicle (A) was pronounced dead on the arrival at a local hospital, and the driver of vehicle (B) was pronounced dead at the scene.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[8](#) [9](#) [10](#) Damage to the front of case vehicle (A) was severe. Direct damage began at the left-front bumper corner and extended 135-cm across the entire front. The maximum crush was 102 cm at the left-front bumper corner.

[11](#) The direct damage to vehicle (B) was to the front and extended 150 cm across the entire front. The maximum crush was 87 cm at the left-front bumper corner. The entire front of the vehicle was crushed rearward, with direct damage extending into the engine compartment. The left wheelbase was reduced 70 cm. There was also minor rollover damage that extended along the entire right side.

[12](#) [13](#) [14](#) [15](#) [16](#) [17](#) [18](#) [19](#) [20](#) Using the WinSMASH accident-reconstruction program and c-values measured for both vehicles, the following impact severities were calculated:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	71 (44)	-70 (-44)	12 (8)
Vehicle (B)	delta V	53 (33)	-53 (-33)	0 (0)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

[21](#) [22](#) In the front of case vehicle (A), the bumper and grille area were severely damaged and pushed rearward into the engine compartment, and both headlight assemblies were broken. [23](#) The hood was severely crushed, the damaged hood latch had released, and both hood hinges were separated, allowing the hood to separate from its hinges. [24](#) [25](#) [26](#) There was direct damage to the top of the hood, to the center portion of the windshield, and to the upper portion of the left A-pillar, from contact with the front of vehicle (B). [27](#) [28](#) There was also a 77-cm tear in the right portion of the windshield, and about 20% bond separation. [29](#) Both sides of the roof were severely buckled due to the rearward movement of the upper A-pillars.

[30](#) On the left side, the front fender was crushed rearward into the left-front wheel, which was damaged and pushed rearward. The front axle was broken, and the left wheelbase was reduced 56 cm. [31](#) The upper portion of the left A-pillar was moved rearward and

stood up almost vertical, and it had been cut during extrication of the driver. [32](#) Also, the damaged and jammed driver door had been pried open by the rescue personnel, and the window glass was broken. [33](#) The lower portion of the A-pillar and the upper and lower portions of the B-pillars were also damaged. [34](#) The left-rear quarter panel was slightly buckled just behind the driver door, but there was no other damage to the left side and no damage to the upper portion of the C-pillar. [35](#) There was no damage to the rear of case vehicle (A).

[36](#) The right fender was deformed and shifted to the left. [37](#) The upper and lower portions of the A-pillar were displaced and the right door was jammed closed. [38](#) There was no damage to the right wheels, although the wheelbase was increased 4 cm. There was no damage to the right B-or C-pillars, and the quarter panel was buckled just behind the right-front door.

Interior

[39](#) [40](#) This vehicle is equipped with steering-wheel and passenger frontal-impact airbags, which deployed during this severe frontal impact. [41](#) [42](#) The driver airbag and the passenger airbag skins had small cuts in the back side of the fabric, probably from broken windshield glass. [43](#) There were no contact marks on the driver airbag. [44](#) Rescue personnel removed the steering-wheel rim/hub and much of the steering column during extrication, so rotation of the steering column could not be determined. [45](#) [46](#) [47](#) [48](#) [49](#) The steering-wheel hub was damaged, the steering-wheel rim was severely bent in a concave manner, and the steering-wheel spokes were damaged, probably due to loading by the unbelted driver through the airbag. [50](#) [51](#) Also in the driver area, the left-front door, the door hardware, and the door armrest appeared to be damaged from the crash, but were also damaged during the driver extrication. [52](#) [53](#) The toe pan, floor area, and the foot controls in the driver area were also damaged and displaced to the rear. [54](#) [55](#) The driver seatback and seat cushion were damaged, the seat adjuster was jammed, and the seatback was rotated forward. [56](#) [57](#) [58](#) The upper and mid portions of the instrument panel in the driver area were displaced and damaged, and the driver knee bolster was damaged. [59](#) [60](#) All components on the instrument panel and dashboard were damaged,

including the ashtray, control knobs, instruments, glove compartment, vents, ducts, and the radio. [61](#) [62](#) [63](#) The interior of the windshield was damaged throughout, the windshield header was displaced to the rear, and the interior areas of both A-pillars were damaged. Also, the roof interior and roof headlining were deformed. [64](#) The right-front seatback was deformed and rotated forward, and the seat adjuster was jammed. [65](#) [66](#) [67](#) The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
left front	windshield	59	to rear
	toepan	36	to rear
	instrument panel	32	to rear
	A-pillar	floor	roof header
steering wheel	30	10	9
unknown	to rear	up	to rear

OCCUPANT KINEMATICS AND INJURIES

[68](#) [69](#) The 5-ft, 4-in, 205-lb, 45-year-old female driver was **not** wearing the three-point belt, and the steering-wheel airbag deployed. [70](#) [71](#) [72](#) There were no marks on the D-ring or belt webbing to indicate that the belt was being used.

[73](#) During the frontal impact, the unbelted female driver moved forward relative to the vehicle interior into the airbag. [74](#) [75](#) She sustained a fractured nose, possibly from contact with the airbag or the upper instrument panel. [76](#) She sustained fractures to the anterior aspects of all ribs with bilateral flail chest, probably from steering-wheel loading through the airbag. She sustained unspecified spinal fractures at the level of T3-T4 from an unknown source. [77](#) [78](#) She sustained lacerations to the lateral aspect of the left forearm, possibly from contact with the driver door and/or door glass, or from contact with the upper portion of the instrument panel. She also sustained lacerations to the lateral aspect of the

right thigh from an unknown source. [79](#) She sustained compound fractures of the distal left femur, and proximal fractures of the left tibia and fibula, from contact with the knee bolster, as indicated by scuff marks on the bolster. She also sustained a laceration to the right knee, from contact with the knee bolster. [80](#) In addition, she sustained a laceration to the lateral aspect of the right ankle, probably from contact with the brake or accelerator pedals, and a dislocation of the right ankle, probably from contact with the brake pedal.

The following table [81](#) and attached drawing summarize the injuries for the unbelted driver.

Occupant: Driver		Age: 45 years		Gender: Female	
Restraints: 3-point belt not worn; airbag deployed		Stature: 163 cm (5 ft, 4 in)		Mass: 93 kg (205 lb)	
Injury Description	A.I.S.	Injury Source			
		Definite	Probable	Possible	
Fracture, nose	1	—	—	Airbag, upper instrument panel	
Fractures to the anterior aspect of all ribs with bilateral flail chest	5	—	Steering wheel through airbag	—	
Unspecified spinal fractures at T3-T4	2	Impact forces	—	—	
Lacerations, lateral aspect of the left forearm	1	—	Door interior/glass	Upper instrument panel	
Lacerations, lateral aspect of the right thigh	1	Unknown	—	—	
Lacerations, anterior aspect of the right knee	1	Knee bolster	—	—	
Compound fractures, distal left femur	3	Knee bolster	—	—	
Compound fractures, proximal left tibia	3	Knee bolster	—	—	
Compound fractures, proximal left fibula	2	Knee bolster	—	—	
Laceration, lateral aspect of the right ankle	1	—	Brake and/or accelerator pedals	—	
Dislocation, right ankle	2	—	Brake pedal	—	
Maximum A.I.S. Level	5	—	—	—	
Injury Severity Score	35	FATAL - autopsy conducted	—	—	

CASE NO.: 201491

CASE HISTORY: 2008 Motorway

TYPE: Collision, 2-vehicle crash

OCCUPANT: (Driver) 40-year-old female

STATUS: 180-54 cm, 65 kg

DATE: 20 August 2014

REPORT MADE BY: Superintendent, approved, sitting deployed

SEVERITY: MAJOR - 8

ISS - 25



Case No.: 201401

Case No. (A): 20000-Warung

Type: Sedan, 4-door coupe

Driver: 40-year-old female

Vehicle (B): 1994 Honda Civic-Breeze MPV, 4-door

Weather: Clear

Road Surface: Dry

Road Construction: Asphalt

Light Condition: Day



Vehicle Report

General

Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	more
V207 — Limited Access Highway	0	No	more
V208 — Road Total Lanes	2	2 lanes	more
V209 — Intersecting Road Total Lanes	8	Not applicable	more
V210 — Road Surface Type	1	Asphalt	more
V211 — Road Defects	0	No	more
V212 — Construction Zone	0	No	more
V213 — Road Alignment Vertical Plane	1	Level	more
V214 — Road Alignment Horizontal Plane	1	Straight	more
V215 — Surface Covering	10	Dry	more
V216 — Visibility Limitation	0	None	more
V217 — Visibility Obstruction	0	None	more
V218 — Speed Limit	4	71-79 km/h .. 45 mph	more
V219 — Precipitation Type	0	None	more
V220 — Precipitation Rate	8	Not applicable	more
V221 — Temperature	9	Unknown	more
V222 — Crosswind	9	Unknown	more
V223 — Light Conditions	5	Dark, unlighted	more
V224 — Mechanical Malfunction Mention	0	No	more
V225 — Case Vehicle and Object	0	No	more
V226 — Case Vehicle Rollover	0	No	more

V227 — Case Vehicle Ran Off Roadway	0	No	more
V228 — Moving Case Vehicle/Contacted Moving Vehicle	1	Yes	more
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	more
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	more
V231 — Total Vehicles Hit By Case Vehicle	1	1 vehicle	more
V232 — Any Fire in Crash	0	No	more
V233 — Max Police Severity-PAR	4	K - Fatal	more
V234 — Driver Alcohol Involvement	0	Had not been drinking	more
V235 — Driver Alcohol BAC	80	Not tested	more
V236 — Driver Impairment Mention	0	No	more
V237 — Driven/Towed From Scene	2	Towed Due to Damage	more

Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN	1GHDT13W2R07	—	—
V302 — Other Vehicle Manufacturer/Body Code	11414	—	—
V303 — Other Vehicle Manufacturer	114	Oldsmobile	more
V304 — Other Vehicle Body Code	14	Short wheelbase utility vehicle (Jeep, Bronco)	more
V305 — Other Vehicle Make/Model	0668	—	—
V306 — Other Vehicle Model Year	1994	—	—
V307 — Other Vehicle Mass	001828 kg	—	—
V308 — Other Vehicle Number	2	Vehicle #2	more
V309 — Other Vehicle Number of Occupants	01	—	—
V310 — Other Vehicle Traveling Speed	999	Unknown	more
V311 — Highest Police Injury Severity	4	K - Fatal	more
V312 — Other Vehicle Type	14	Small utility (wheelbase <107", e.g. Jeep)	more
V313 — Other Vehicle Wheelbase (cm)	272 cm	—	—
V314 — Average Track Width	139 cm	—	—
V315 — Overall Length	454 cm	—	—
V316 — Overall Width (OAW)	166 cm	—	—
V317 — Front Overhang (FOH)	078 cm	—	—
V318 — Rear Overhang (ROH)	104 cm	—	—
V319 — Undeformed End Width (UEW)	150 cm	—	—
V320 — Engine Displacement	4.3 l	—	—
V321 — Engine: Number of Cylinders	06	—	—
V322 — Direct Damage Length (DDL)	150 cm	—	—
V323 — Front-End Overlap % (FEO)	98	98% or more	more
V324 — Vehicle Overlap % (VOL)	98	98% or more	more

Case Vehicle

General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	1ZWFT61L5Y56	—	—
V402 — Manufacturer/Body Code	12228	—	—
V403 — Vehicle Manufacturer	122	Lincoln-Mercury	more
V404 — Vehicle Body Code	28	—	—
V405 — Make/Model Code	0922	Cougar	more
V406 — Model Year	2000	—	—
V407 — Vehicle Mass	001392 kg	—	—
V408 — Odometer Reading	888888	—	—
V409 — Number of Occupants	01	—	—
V410 — Traveling Speed	999	Unknown	more
V411 — Body Type	12	2-door sedan or coupe (any upper B-pillar)	more
V412 — Stolen Vehicle	8	Not currently collected	more
V413 — Body Structure	2	Unitized	more
V414 — Transmission Type	1	Automatic	more
V415 — Transmission Lever Location	2	Console	more
V416 — Steering	1	Power	more
V417 — Brakes	1	Power	more
V418 — Brake Type	2	Disc - front wheels	more
V419 — Brake Anti-lock Device	2	Four-wheel	more
V420 — Air Conditioning in Vehicle	8	Not currently collected	more
V421 — Drive Type	2	Front wheel	more
V422 — Dual Rear Wheels	0	No	more
V423 — Original Restraint System Type	3	Airbag	more

V424 — Equipped With Roll Bar	0	No	more
V425 — Roof Type	1	Solid	more
V426 — Wheelbase	270 cm	—	—
V427 — Anti-lacerative Glass	0	None	more
V428 — Average Track Width	150 cm	—	—
V429 — Overall Length	470 cm	—	—
V430 — Overall Width (OAW)	177 cm	—	—
V431 — Front Overhang	099 cm	—	—
V432 — Rear Overhang	103 cm	—	—
V433 — Undeformed End Width (UEW)	135 cm	—	—
V434 — Engine Displacement	2.5 l	—	—
V435 — Engine: Number of Cylinders	06	—	—
V436 — Direct Damage Length (DDL)	135 cm	—	—
V437 — Front End Overlap % (FEO)	98	98% or more	more
V438 — Vehicle Overlap % (VOL)	98	98% or more	more

Case Vehicle

Damage

Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	102 cm	—	—
V502 — Maximum Crush - Right Side	000 cm	No crush (or less than 1 cm.)	more
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	more
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	more
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	more
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	more
V507 — Are Events In Chronological Order	1	Yes	more
V508 — Event 1 Impact Location	1	On Roadway	more
V509 — Event 1 Impact Configuration	11	FRONT of case veh - FRONT of contacted Vehicle	more
V510 — Event 1 Object/Vehicle Contacted	14	Small utility (wheelbase <107", e.g. Jeep)	more
V511 — Event 2 Impact Location	8	No 2nd event	more
V512 — Event 2 Impact Configuration	88	No 2nd event	more
V513 — Event 2 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V514 — Event 3 Impact Location	8	No 3rd event	more
V515 — Event 3 Impact Configuration	88	No 3rd event	more
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V517 — Event 4 Impact Location	8	No 4th event	more
V518 — Event 4 Impact Configuration	88	No 4th event	more
V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V520 — Event 5 Impact Location	8	No 5th event	more
V521 — Event 5 Impact Configuration	88	No 5th event	more
V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V523 — Event 6 Impact Location	8	No 6th event	more

V524 — Event 6 Impact Configuration	88	No 6th event	more
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V526 — Event 7 Impact On Road	8	No 7th event	more
V527 — Event 7 Impact Configuration	88	No 7th event	more
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V529 — Primary CDC Case Vehicle -event Number	1	Event 1	more
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	more
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	more
V532 — Primary CDC Case Vehicle -crush	102	—	—
V533 — Primary CDC Case Vehicle -clock #1	12	12 o'clock	more
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	more
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	more
V536 — Primary CDC Case Vehicle letter 3 #1	01	A - All	more
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	more
V538 — Primary CDC Case Vehicle Extent #1	06	Extent 6	more
V539 — Primary CDC Case Vehicle -CDC #1	12FDAW6	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	999	Unknown	more
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	more
V549 — Primary CDC Contacted Vehicle -crush	087	—	—
V550 — Primary CDC Contacted Vehicle -clock #1	12	12 o'clock	more
V551 — Primary CDC Contacted Vehicle letter 1	06	F - Front	more

#1			
V552 — Primary CDC Contacted Vehicle letter 2 #1	04	D - Distributed (Side or End) or (F + P + B)	more
V553 — Primary CDC Contacted Vehicle letter 3 #1	05	E - Everything below belt line	more
V554 — Primary CDC Contacted Vehicle letter 4 #1	23	W - Wide impact area	more
V555 — Primary CDC Contacted Vehicle Extent #1	04	Extent 4	more
V556 — Primary CDC Contacted Vehicle -CDC #1	12FDEW4	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V563 — Primary CDC Contacted Vehicle -CDC #2	9800000	—	—
V564 — Secondary CDC Case Vehicle - Event No	8	Not applicable	more
V565 — Secondary CDC Case Vehicle - Impact Speed	998	Not Applicable	more
V566 — Secondary CDC Case Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	more
V567 — Secondary CDC Case Vehicle -crush	998	Not Applicable	more
V568 — Secondary CDC Case Vehicle -clock #1	98	Not Applicable	more
V569 — Secondary CDC Case Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V570 — Secondary CDC Case Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V571 — Secondary CDC Case Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V572 — Secondary CDC Case Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V573 — Secondary CDC Case Vehicle Extent #1	00	Missing Data/Not applicable	more
V574 — Secondary CDC Case Vehicle -CDC #1	9800000	—	—

V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	more
V583 — Secondary CDC Contacted Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	more
V584 — Secondary CDC Contacted Vehicle - crush	998	Not Applicable	more
V585 — Secondary CDC Contacted Vehicle - clock #1	98	Not Applicable	more
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	more
V591 — Secondary CDC Contacted Vehicle - CDC #1	9800000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V598 — Secondary CDC Contacted Vehicle - CDC #2	9800000	—	—

Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	071 kph	—	—
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-070 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	0012 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	0172 kJ	—	—
V606 — Primary Impact Case Vehicle - reconstruction	22	Reconstructed, moderate confidence level	more
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	053 kph	—	—
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	-053 kph	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	0000 kph	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	0338 kJ	—	—
V612 — Case Vehicle Secondary Impact Number	8	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	888	N/A	more
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	8888	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	8888	—	—
V617 — Secondary Case Vehicle Reconstruction Note	88	—	—
V618 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	more

V619 — Secondary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	more
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	071 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-070 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0012 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0172 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	more
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V630 — Primary Contacted Vehicle Reconstruction Total EBS	053 kph	—	—
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	-053 kph	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	0000 kph	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	0338 kJ	—	—
V634 — Case Vehicle Secondary Impact Number	8	Not applicable	more
V635 — Secondary Case Vehicle Reconstruction Total EBS	888	N/A	more
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	8888	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	8888	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	8888	—	—
V639 — Secondary Case Vehicle Reconstruction	88	—	—

Note			
V640 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	more
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	more
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	more
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	135 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	102 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	092 cm	—	—
V650 — Case Vehicle Impact 1 C1	102 cm	—	—
V651 — Case Vehicle Impact 1 C2	077 cm	—	—
V652 — Case Vehicle Impact 1 C3	061 cm	—	—
V653 — Case Vehicle Impact 1 C4	043 cm	—	—
V654 — Case Vehicle Impact 1 C5	026 cm	—	—
V655 — Case Vehicle Impact 1 C6	008 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	0000 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	1	—	—
V658 — Case Vehicle Impact 2 Plane	1	Bumper	more
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	150 cm	—	—
V660 — Case Vehicle Impact 2 Max Crush	087 cm	—	—
V661 — Case Vehicle Impact 2 Field-L	142 cm	—	—
V662 — Case Vehicle Impact 2 C1	087 cm	—	—
V663 — Case Vehicle Impact 2 C2	084 cm	—	—
V664 — Case Vehicle Impact 2 C3	079 cm	—	—

V665 — Case Vehicle Impact 2 C4	064 cm	—	—
V666 — Case Vehicle Impact 2 C5	032 cm	—	—
V667 — Case Vehicle Impact 2 C6	022 cm	—	—
V668 — Case Vehicle Impact 2 +/- D	0000 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	2	—	—
V670 — Other Vehicle Impact 1 Plane	4	Above sill	more
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	449 cm	—	—
V672 — Other Vehicle Impact 1 Max Crush	001 cm	—	—
V673 — Other Vehicle Impact 1 Field-L	999	Unknown	more
V674 — Other Vehicle Impact 1 C1	999	Unknown	more
V675 — Other Vehicle Impact 1 C2	999	Unknown	more
V676 — Other Vehicle Impact 1 C3	999	Unknown	more
V677 — Other Vehicle Impact 1 C4	999	Unknown	more
V678 — Other Vehicle Impact 1 C5	999	Unknown	more
V679 — Other Vehicle Impact 1 C6	999	Unknown	more
V680 — Other Vehicle Impact 1 +/- D	0999 cm	—	—
V681 — Other Vehicle Reconstructed Impact Number	2	—	—
V682 — Other Vehicle Impact 2 Plane	8	Not applicable	more
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	998	Not applicable	more
V684 — Other Vehicle Impact 2 Max Crush	998	Not applicable	more
V685 — Other Vehicle Impact 2 Field-L	998	Not applicable	more
V686 — Other Vehicle Impact 2 C1	998	Not applicable	more
V687 — Other Vehicle Impact 2 C2	998	Not applicable	more
V688 — Other Vehicle Impact 2 C3	998	Not applicable	more
V689 — Other Vehicle Impact 2 C4	998	Not applicable	more
V690 — Other Vehicle Impact 2 C5	998	Not applicable	more
V691 — Other Vehicle Impact 2 C6	998	Not applicable	more
V692 — Other Vehicle Impact 2 +/- D	9998	—	—

Case Vehicle

Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	1	Yes	more
V702 — Right Front Wheel Damaged	0	No	more
V703 — Right Rear Wheel Damaged	0	No	more
V704 — Left Rear Wheel Damaged	0	No	more
V705 — Left Front Tire Tread Type	4	All Weather	more
V706 — Right Front Tire Tread Type	4	All Weather	more
V707 — Right Rear Tire Tread Type	4	All Weather	more
V708 — Left Rear Tire Tread Type	4	All Weather	more
V709 — Left Front Carcass Construction	3	Radial	more
V710 — Right Front Carcass Construction	3	Radial	more
V711 — Right Rear Carcass Construction	3	Radial	more
V712 — Left Rear Carcass Construction	3	Radial	more
V717 — Left Front Tire Size	60R1560R15	—	—
V718 — Right Front Tire Size	60R1560R15	—	—
V719 — Right Rear Tire Size	60R1560R15	—	—
V720 — Left Rear Tire Size	60R1560R15	—	—

Case Vehicle

Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	more
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	more
V803 — Main Filler Cap Location	133	—	—
V804 — Main Tank Material	9	Unknown	more
V805 — Aux Tank Type	8	Not applicable (not equipped)	more
V806 — Aux Tank Location	888	Not applicable (not equipped)	more
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	more
V808 — Aux Tank Material	8	Not applicable	more
V901 — Fuel Leakage From Crash	0	No	more
V1001 — Fire In Or On Case Vehicle	0	No	more

Case Vehicle

Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	1	Yes	more
V1102 — Hood Latch Damaged	1	Yes	more
V1103 — Hood Latch Jammed	0	No	more
V1104 — Left Hood Hinge Damaged	1	Yes	more
V1105 — Left Hood Hinge Separated	1	Yes	more
V1106 — Right Hood Hinge Damaged	1	Yes	more
V1107 — Right Hood Hinge Separated	1	Yes	more
V1108 — Hood Remained On Vehicle	0	No	more
V1109 — Rear Hood Edge Elevated	1	Yes	more
V1110 — Edge Contacted Windshield	1	Yes	more
V1111 — Edge Penetrated Windshield	0	No	more
V1112 — Hood Latch Location	1	Front of Vehicle	more
V1113 — Eng/Transmissn Mount Separation	0	No	more
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	more
V1115 — Steerng Column Coupling Damaged	9	Unknown	more
V1116 — Steerng Column Coupling Separated	9	Unknown	more
V1117 — Eng Comp Telescopng Unit	88	Not collected	more
V1118 — Comp Orig/Telescopd Diff	888	Not collected	more
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	more

V1120 — Upper Left A-pillar Separation	4	No separation, but damaged	more
V1121 — Lower Left A-pillar Separation	4	No separation, but damaged	more
V1122 — Upper Left B-pillar Separation	4	No separation, but damaged	more
V1123 — Lower Left B-pillar Separation	4	No separation, but damaged	more
V1124 — Upper Left C-pillar Separation	0	No	more
V1125 — Lower Left C-pillar Separation	8	Not applicable (not equipped)	more
V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	more
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	more
V1128 — Left Front Door Opening Cause	0	Door did not open	more
V1129 — Left Rear Door Opening Cause	8	Not applicable (no left rear door)	more
V1130 — Left Front Door Jammed Closed	1	Yes	more
V1131 — Left Rear Door Jammed Closed	8	Not applicable (no left rear door)	more
V1132 — Rear Door Type	1	Hatchback	more
V1133 — Rear Door Opening Cause	0	Door did not open	more
V1134 — Rear Door Jammed Closed	0	No	more
V1135 — Luggage Partition Damagd	8	Not applicable	more
V1136 — Spare Tire Status	8	Not collected	more
V1137 — Trailer Hitch Type	0	No hitch	more
V1138 — Trailer Type	0	No trailer	more
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	more
V1140 — Upper Right A-pillar Separation	4	No separation, but damaged	more
V1141 — Lower Right A-pillar Separation	4	No separation, but damaged	more
V1142 — Upper Right B-pillar	0	No	more

Separation			
V1143 — Lower Right B-pillar Separation	0	No	more
V1144 — Upper Right C-pillar Separation	0	No	more
V1145 — Lower Right C-pillar Separation	8	Not applicable (not equipped)	more
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	more
V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	more
V1148 — Right Front Door Opening Cause	00	Door did not open	more
V1149 — Right Rear Door Opening Cause	98	Not applicable (no right rear door)	more
V1150 — Right Front Door Jammed Closed	1	Yes	more
V1151 — Right Rear Door Jammed Closed	8	Not applicable (no right rear door)	more
V1152 — Van Rear Door Type	8	Not applicable (not a van)	more
V1153 — Windshield Cracked		Yes	more
V1154 — Windshield Broken	1	Yes	more
V1155 — Windshield Cracked or Broken by Occupant	0	No	more
V1156 — Bond Separation Extent	1	1 - 20%	more
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	more

Case Vehicle

Steering

Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	2	Severely bent	more
V1202 — Number of Steering Wheel Spokes	4	4 spokes	more
V1203 — Steering Wheel Spoke Damage	2	Severely bent	more
V1204 — Column Tilt Feature	0	Not equipped	more
V1205 — Column Swing-away Feature	0	Not equipped	more
V1206 — Column Telescoping Feature	0	Not equipped	more
V1207 — Wheel Energy Absorb Device	8	Not collected	more
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	more
V1209 — Column Energy Absorb Device	88	Not collected	more
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	more
V1211 — Shear Capsule Separation	888	Not collected	more
V1212 — Column Vertical Rotation	9	Unknown	more
V1213 — Column Lateral Rotation	9	Unknown	more
V1214 — Steering Wheel Hub Damage	1	Occupant contact	more

Case Vehicle

Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	1	Yes	more
V1302 — Was Intrusion Catastrophic	0	No	more
V1303 — Intrusion Number 01	01	Intrusion #1	more
V1304 — Intrusion 01 Occupant Space Number	11	First row, Left seat	more
V1305 — Intrusion 01 Intruding Object	06	Windshield	more
V1306 — Intrusion 01 Assoc Event Number	1	Event #1	more
V1307 — Intrusion 01 Max Intrusion X-axis	59 cm	—	—
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	more
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	more
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	more
V1313 — Intrusion 01 Injury Number	00	No injury or no intrusion	more
V1314 — Intrusion Number 02	02	Intrusion #2	more
V1315 — Intrusion 02 Occupant Space Number	11	First row, Left seat	more
V1316 — Intrusion 02 Intruding Object	03	Toe pan	more
V1317 — Intrusion 02 Assoc Event Number	1	Event #1	more
V1318 — Intrusion 02 Max Intrusion X-axis	36 cm	—	—
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1321 — Intrusion 02 Occupant Number	00	No contact or no intrusion	more
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	more
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	more
V1324 — Intrusion 02 Injury Number	00	No injury or no intrusion	more

V1325 — Intrusion Number 03	03	Intrusion #3	more
V1326 — Intrusion 03 Occupant Space Number	11	First row, Left seat	more
V1327 — Intrusion 03 Intruding Object	01	Instrument panel	more
V1328 — Intrusion 03 Assoc Event Number	1	Event #1	more
V1329 — Intrusion 03 Max Intrusion X-axis	32 cm	—	—
V1330 — Intrusion 03 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1332 — Intrusion 03 Occupant Number	01	Occupant number 1, contact	more
V1333 — Intrusion 03 Injury Number	01	Injury #1	more
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	more
V1335 — Intrusion 03 Injury Number	00	No injury or no intrusion	more
V1336 — Intrusion Number 04	04	Intrusion #4	more
V1337 — Intrusion 04 Occupant Space Number	11	First row, Left seat	more
V1338 — Intrusion 04 Intruding Object	08	A-pillar	more
V1339 — Intrusion 04 Assoc Event Number	1	Event #1	more
V1340 — Intrusion 04 Max Intrusion X-axis	30 cm	—	—
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	more
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	more
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	more
V1346 — Intrusion 04 Injury Number	00	No injury or no intrusion	more
V1347 — Intrusion Number 05	05	Intrusion #5	more
V1348 — Intrusion 05 Occupant Space Number	11	First row, Left seat	more
V1349 — Intrusion 05 Intruding Object	04	Floor pan	more
V1350 — Intrusion 05 Assoc Event Number	1	Event #1	more
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more

V1353 — Intrusion 05 Max Intrusion Z-axis	10 cm	—	—
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	more
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	more
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	more
V1357 — Intrusion 05 Injury Number	00	No injury or no intrusion	more
V1358 — Intrusion Number 06	06	Intrusion #6	more
V1359 — Intrusion 06 Occupant Space Number	11	First row, Left seat	more
V1360 — Intrusion 06 Intruding Object	07	Windshield header	more
V1361 — Intrusion 06 Assoc Event Number	1	Event #1	more
V1362 — Intrusion 06 Max Intrusion X-axis	09 cm	—	—
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1368 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1369 — Intrusion Number 07	00	No Intrusion, None	more
V1370 — Intrusion 07 Occupant Space Number	00	No Intrusion, None	more
V1371 — Intrusion 07 Intruding Object	00	No Intrusion, None	more
V1372 — Intrusion 07 Assoc Event Number	0	No Intrusion, None	more
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	more
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	more
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	more
V1379 — Intrusion 07 Injury Number	99	Contact, injury unknown or data not collected	more
V1380 — Intrusion Number 08	00	No Intrusion, None	more

V1381 — Intrusion 08 Occupant Space Number	00	No Intrusion, None	more
V1382 — Intrusion 08 Intruding Object	00	No Intrusion, None	more
V1383 — Intrusion 08 Assoc Event Number	0	No Intrusion, None	more
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	more
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	more
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	more
V1390 — Intrusion 08 Injury Number	99	Contact, injury unknown or data not collected	more
V1391 — Intrusion Number 09	00	No Intrusion, None	more
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	more
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	more
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	more
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	more
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	more
V1402 — Intrusion Number 10	00	No Intrusion, None	more
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	more
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	more
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	more
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more

V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	more
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	more
V1413 — Door Intrusion Number 01	88	Not Applicable	more
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	more
V1415 — Door Intrusion Number 02	88	Not Applicable	more
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	more
V1417 — Door Intrusion Number 03	88	Not Applicable	more
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	more
V1419 — Door Intrusion 01 Component	88	Not Applicable	more
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	more
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	more
V1422 — Door Intrusion 02 Component	88	Not Applicable	more
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	more
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	more
V1425 — Door Intrusion 03 Component	88	Not Applicable	more
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	more
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	more
V1428 — Door Intrusion 04 Component	88	Not Applicable	more
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	more
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	more

Case Vehicle

Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	more
V1502 — Driver Airbag Deployed	1	Yes	more
V1503 — Driver Airbag Condition	3	Cut during crash	more
V1504 — Passenger Airbag Equip	1	Yes	more
V1505 — Passenger Airbag Deployed	1	Yes	more
V1506 — Passenger Airbag Condition	3	Cut during crash	more
V1507 — Steering Wheel Airbag Tether	1	Yes	more
V1508 — Driver Airbag Marked By Contact	0	No	more
V1509 — Passenger Airbag Tether	0	No	more
V1510 — Passenger Airbag Marked By Contact	0	No	more

Case Vehicle

Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	1	Yes	more
V1602 — Right Front Door Damaged	0	No	more
V1603 — Left Front Hardware Damaged	1	Yes	more
V1604 — Right Front Hardware Damaged	0	No	more
V1605 — Left Front Armrest Damaged	1	Yes	more
V1606 — Right Front Armrest Damaged	0	No	more
V1607 — Left Front Glass Damaged	1	Yes	more
V1608 — Right Front Glass Damaged	0	No	more
V1609 — Left Rear Door Area Damaged	0	No	more
V1610 — Right Rear Door Area Damaged	0	No	more
V1611 — Left Rear Hardware Damaged	0	No	more
V1612 — Right Rear Hardware Damaged	0	No	more
V1613 — Left Rear Armrest Damaged	0	No	more
V1614 — Right Rear Armrest Damaged	0	No	more
V1615 — Left Rear Glass Damaged	0	No	more
V1616 — Right Rear Glass Damaged	0	No	more
V1617 — Left Roof Side Rail Damaged	1	Yes	more
V1618 — Right Roof Side Rail Damaged	0	No	more

V1619 — Left B-pillar Damaged	0	No	more
V1620 — Right B-pillar Damaged	0	No	more
V1621 — Left C-pillar Damaged	0	No	more
V1622 — Right C-pillar Damaged	0	No	more
V1623 — Left D-pillar Damaged	8	Not applicable	more
V1624 — Right D-pillar Damaged	0	No	more
V1625 — Left Headlining Damaged	1	Yes	more
V1626 — Right Headlining Damaged	1	Yes	more
V1627 — Left Roof Structure Damaged	1	Yes	more
V1628 — Right Roof Structure Damaged	1	Yes	more
V1629 — Left T/Sun Roof Damaged	8	Not applicable	more
V1630 — Right T/Sun Roof Damaged	8	Not applicable	more
V1631 — Other Left Side Item Damagd	8	Not applicable	more
V1632 — Other Right Side Item Damagd	8	Not applicable	more
V1633 — Foot Controls Damaged	4	Yes, occupant contact	more
V1634 — Ignition Key Damaged	1	Yes	more
V1635 — Rear View Mirror Damaged	1	Yes	more
V1636 — Sunvisor/Fitting Damaged	5	Left side only	more
V1637 — Windshield Molding Damaged	1	Yes	more
V1638 — Left A-pillar Damaged	1	Yes	more
V1639 — Right A-pillar Damaged	1	Yes	more
V1640 — Center Console Damaged	1	Yes	more
V1641 — Transmission Lever Damaged	1	Yes	more
V1642 — Horn/Spoke Shroud Damagd	0	No	more
V1643 — Upper Panel Damaged	1	Yes	more

V1644 — Mid Panel Damaged	1	Yes	more
V1645 — Lower Panel Damaged	1	Yes	more
V1646 — Ashtray Damaged	1	Yes	more
V1647 — Control Knob/Lever Damaged	1	Yes	more
V1648 — Glove Compartment Area Damaged	1	Yes	more
V1649 — Instruments Damaged	1	Yes	more
V1650 — Park Brake Release Damaged	1	Yes	more
V1651 — Park Brake Pedal Damaged	1	Yes	more
V1652 — A/C Or Upper Vent Damaged	1	Yes	more
V1653 — Heater Or A/C Duct Damaged	1	Yes	more
V1654 — Radio Damaged	1	Yes	more
V1655 — Other Item Damaged	8	Not applicable	more
V1656 — Rear Window Damaged	0	No	more
V1657 — Rear Window Header Damaged	0	No	more
V1658 — Vertical Console Damaged	8	Not applicable	more
V1659 — Roof Console Damaged	8	Not applicable	more

Case Vehicle

Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	more
V1702 — Passenger Front Seat Type	05	Bucket	more
V1703 — Driver Seat Mount Type	1	Standard	more
V1704 — Passenger Seat Mount Type	1	Standard	more
V1705 — Driver Swivel Mechanism Equipped	0	No	more
V1706 — Passenger Swivel Mechanism Equipped	0	No	more
V1707 — Driver Seat Original Equipment	1	Yes	more
V1708 — Passenger Seat Original Equipment	1	Yes	more
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	more
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	more
V1711 — Driver Seat Damage	3	Backrest and cushion damaged	more
V1712 — Passenger Seat Damage	1	Backrest only damaged	more
V1713 — Center Front Armrest Damaged	8	Not applicable (no center armrest)	more
V1714 — Driver Seat Rotation	1	Forward apparent	more
V1715 — Passenger Seat Rotation	1	Forward apparent	more
V1716 — Driver Seat-back Type	1	Forward folding	more
V1717 — Passenger Seat-back Type	1	Forward folding	more
V1718 — Driver Seat-back Lock Type	1	Manual	more
V1719 — Passenger Seat-back Lock Type	1	Manual	more
V1720 — Driver Seat-back Lock Held	1	Yes	more
V1721 — Passenger Seat-back Lock Held	1	Yes	more

V1722 — Driver Recliner Mechanism Held	1	Yes	more
V1723 — Passenger Recliner Mechanism Held	1	Yes	more
V1724 — Driver Head Restraint Type	2	Integral	more
V1725 — Passenger Head Restraint Type	2	Integral	more
V1726 — Driver Head Rest Removed	8	Not applicable	more
V1727 — Passenger Head Rest Removed	8	Not applicable	more
V1728 — Driver Head Rest Adjustment	8	Not applicable	more
V1729 — Passenger Head Rest Adjustment	8	Not applicable	more
V1730 — Driver Head Rest Damage	0	None	more
V1731 — Passenger Head Rest Damage	0	None	more
V1732 — Driver Seat Adjustment Type	1	Manual	more
V1733 — Passenger Seat Adjustment Type	1	Manual	more
V1734 — Driver Seat Adjustment Provided	1	2-way	more
V1735 — Passenger Seat Adjustment Provided	1	2-way	more
V1736 — Driver Seat Adjuster Damage	2	Deformed (released/jammed)	more
V1737 — Passenger Seat Adjuster Damage	2	Deformed (released/jammed)	more
V1738 — Driver Seat Adjuster Separation	0	None	more
V1739 — Passenger Seat Adjuster Separation	0	None	more
V1740 — Driver Seat Pre-crash Position	9	Unknown	more
V1741 — Passenger Seat Pre-crash Position	9	Unknown	more
V1742 — Left Rear Seat Type	2	Folding	more
V1743 — Right Rear Seat Type	2	Folding	more
V1744 — Left Rear Seat Damaged	0	None	more
V1745 — Right Rear Seat Damaged	0	None	more
V1746 — Center Rear Armrest Damaged	8	Not applicable (No Center Armrest)	more

V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	more
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	more
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	more
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	more
V1751 — Left Rear Seat-back Right Lock Equipped	0	No	more
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	more
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	more
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	more
V1755 — Left 3rd Seat Equipped	0	No	more
V1756 — Right 3rd Seat Equipped	0	No	more
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	more
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	more
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	more
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	more
V1761 — Rear Head Restraints	1	Equipped	more

RELATIONSHIPS TO IN-CENTRAL HINGE

 


Impact
Crash height




Impact #1

150 on-direct damage
40 on-max crush to-C1



hole from interior object

 

Impact #2 rollover to right side

400 down damage
8-10m into crush

MEASUREMENTS IN CENTIMETERS



Original
Bumper Height



134

134



Bumper corner
damage
100

Post-crash

214

Bumper corner
damage
100



135 cm direct damage
160-cm max crush at C1



Bumper corner
damage
100

 
Post-crash

 
214

Bumper corner
damage
100

WINDSHIELD MARK ON CASE VEHICLE:


UNKNOWN





no evidenced of belt use

lower half and right portion of
steering wheel deformed

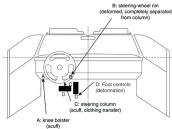

APPROX. HUBBARD ON DRIVER SIDE:



Notes:  15
If yes, how many: _____

Notes:  15
If yes, how many: _____

Driver's Mirror/View



Rectangle ADEG



Answer: 184
If you have more: _____

Rectangle ADEG (Area)

Single Area



Answer: 738
If you have more: _____

1 = Definitely 2 = Probably 3 = Possible

INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)					Dominant Crush Direction
		Comparison Value	–	Intruded Value	=	Intrusion	
11	Windshield	124	–	65	=	59	To rear
11	Toe pan	121	–	85	=	36	To rear
11	Instrument panel	81	–	49	=	32	To rear
11	A-pillar	80	–	50	=	30	To rear
11	Floor		–		=	10	Up
11	Windshield header	43	–	34	=	9	To rear
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		

OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Knee bolster	1	Knee/leg	Scuff, broken	1
B	Steering wheel rim	1	Head	Lower half and right portion of rim deformed	1
C	Steering column	1	Leg	Clothing transfer, scuff	1
D	Brake and accelerator pedals	1	Right foot	Deformation	2
E					

Case # 301: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	54	Upper instrument panel	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	03	Central	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FCFS1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	02	Back	more
V2105 — Primary OIC -aspect	19	Superior/upper	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	BSFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	02	Bilateral	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	5	Critical	more
V2109 — Primary OIC	CBFS5	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	more
V2102 — 1st Prob Contact Area	20	Surface of side interior	more
V2103 — 2nd Prob Contact Area	22	Window glass (side)	more
V2104 — Primary OIC -body Region	18	Forearm	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	RLLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	20	Thigh	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	TRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	11	Knee	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	KRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	20	Thigh	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	TLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	12	Leg (lower)	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	LLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	12	Leg (lower)	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	LLFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	more
V2102 — 1st Prob Contact Area	28	Foot controls (including parking brake pedal)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	QRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury #11

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	11	Injury #11	more
V2102 — 1st Prob Contact Area	28	Foot controls (including parking brake pedal)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	04	Dislocation	more
V2107 — Primary OIC -system/Organ	10	Joints	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRDJ 2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1; Injury #12

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	12	Injury #12	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	02	Back	more
V2105 — Primary OIC -aspect	19	Superior/upper	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	BSFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 301: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	more
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	more
V2003 — Occupant Position -row	1	1st row	more
V2004 — Occupant Position -lateral	1	Left	more
V2005 — Occupant Position -posture	10	Sitting on seat	more
V2006 — Occupant Age In Years	45	—	—
V2007 — Occupant Age In Months	25	25 months or older	more
V2008 — Occupant Mass	093 kg	—	—
V2009 — Occupant Height	163 cm	—	—
V2010 — Occupant Sex	2	Female	more
V2011 — Occupant Treatment/Mortality	05	Fatal - dead at scene	more
V2012 — Injury Severity Score	35	—	—
V2013 — Non-impact Med Condition	0	None	more
V2014 — Police Injury Severity	4	K - Fatal	more
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	more
V2016 — Active Restraint Usage	0	None (available but not used)	more
V2017 — Passive Restraint System	1	Air bag installed	more
V2018 — Passive Restraint Usage	2	Air bag deployed	more
V2019 — Child Seat Type	88	Not applicable (adult or older child)	more
V2020 — Occupant Ejection Degree	0	None	more
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	more
V2022 — Highest OIC Severity	5	Critical	more

V2023 — Head Restraint Available	1	Equipped	more
V2024 — Occupant Eyewear	9	Unknown	more
V2025 — Source of Occupant Info	2	Autopsy	more

















































































































Bravada













